


SERVICE BULLETIN NO. 125**Loose bolts and nuts on transformer 20800024**

It has come to our notice that on transformer 20800024 the bolts and nuts come loose during operation. We have notified the supplier who will insert self-locking nuts to prevent the problem from arising again.

Service engineers who encounter this fault in the field should insert 4 x 5 mm fan-type lock washers, part No 057505, between bracket and nut.

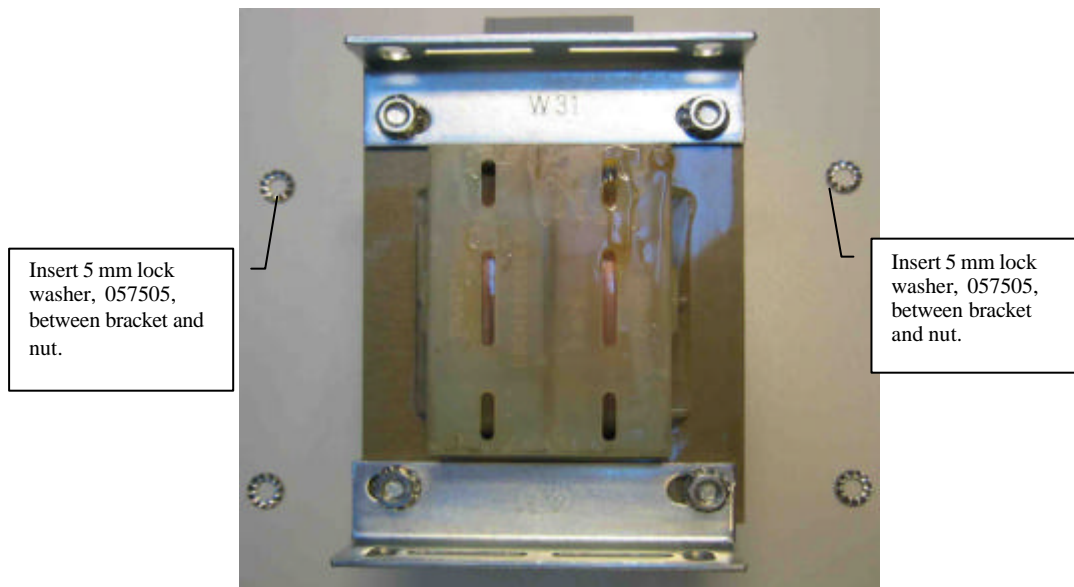

Yours sincerely,

HOUNÖ A/S

Sales & Technical Support
Customer Centre

Tlf. : +45 8711 4711

Fax : +45 8711 4710

E-mail : kundecenter@houno.com

Website : <http://www.houno.com>